

Fischer Connectors SA Saint-Prex, Switzerland Phone +41 21 800 95 95 Fax +41 21 800 39 24 www.fischerconnectors.com mail@fischerconnectors.ch

Crimping Instructions

Assembly Instructions

Section 1	CONTENTS Page	
Scope 2	Section 1	
Introduction		
Section 2a Overall Product Range Crimp contacts Wire size and tool chart Barrel dimensions and stripping length Crimping and assembly tools Crimping and assembly tools Table 3a Crimp contacts WARNING: Epoxy potting required Wire size and tool chart Barrel dimensions and stripping length Crimping and assembly tools Table 3b Crimping and assembly tools Crimping 12 Strand damage and end cuts Stripping 12 Strand damage and end cuts Conductor deformation/birdcaging 13 Cleanliness Conductor deformation/birdcaging 13 Examples of stripping faults Crimping 15 Conductor location 15 Deformation of the crimp barrel 15 Mechanical properties of the crimped connection 16 Methods for building up conductor cross-section 16 Methods for building up conductor cross-section 16 Assembly in connector 17	·	
• Crimp contacts • Wire size and tool chart • Barrel dimensions and stripping length • Recommended crimp tool settings • Crimping and assembly tools Section 2b Only for UltiMate™ Size 08 and 11 • Crimp contacts • WARNING: Epoxy potting required • Wire size and tool chart • Barrel dimensions and stripping length • Barrel dimensions and stripping length • Crimping and assembly tools Section 3 Crimping and assembly tools Section 3 Crimping and assembly tools 10 Section 3 Crimping and assembly tools 11 Crimp process 12 • Preparation 12 • Stripping 12 • Strand damage and end cuts 13 • Wire insulation damage 13 • Conductor deformation/birdcaging 13 • Conductor deformation/birdcaging 13 • Conductor focation 15 • Conductor location 15 • Deformation of the crimp barrel • Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17	• Introduction 2	
• Crimp contacts • Wire size and tool chart • Barrel dimensions and stripping length • Recommended crimp tool settings • Crimping and assembly tools Section 2b Only for UltiMate™ Size 08 and 11 • Crimp contacts • WARNING: Epoxy potting required • Wire size and tool chart • Barrel dimensions and stripping length • Barrel dimensions and stripping length • Crimping and assembly tools Section 3 Crimping and assembly tools Section 3 Crimping and assembly tools 10 Section 3 Crimping and assembly tools 11 Crimp process 12 • Preparation 12 • Stripping 12 • Strand damage and end cuts 13 • Wire insulation damage 13 • Conductor deformation/birdcaging 13 • Conductor deformation/birdcaging 13 • Conductor focation 15 • Conductor location 15 • Deformation of the crimp barrel • Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17		
- Wire size and tool chart - Table 1a - 4 - P/N - AWG - Barrel dimensions and stripping length - Table 2a - 5 - Recommended crimp tool settings - Table 3a - 6 - Crimping and assembly tools - 7 - Table 3a - 6 - Crimping and assembly tools - 7 - Table 3a - 6 - Crimping and assembly tools - Table 3b - Crimp contacts - WARNING: Epoxy potting required - 9 - Wire size and tool chart - Table 1b - 9 - P/N - AWG - Barrel dimensions and stripping length - Table 2b - 9 - Recommended crimp tool settings - Table 3b - 10 - Crimping and assembly tools - 10 - Table 3b - 10 - Crimping and assembly tools - 10 - Stripping - 12 - Strand damage and end cuts - 13 - Wire insulation damage - 13 - Cleanliness - 13 - Cleanliness - 13 - Conductor deformation/birdcaging - 13 - Examples of stripping faults - 14 - Crimping - 15 - Conductor location - 15 - Deformation of the crimp barrel - Mechanical properties of the crimped connection - 16 - Methods for building up conductor cross-section - 16 - Methods for building up conductor cross-section - 16 - Assembly in connector - 17	Section 2a Overall Product Range 3	
- Barrel dimensions and stripping length	• Crimp contacts 4	
Recommended crimp tool settings - Table 3a 6 Crimping and assembly tools 7 Section 2b Only for UltiMate™ Size 08 and 11 8 Crimp contacts 9 - WARNING: Epoxy potting required 9 - Wire size and tool chart - Table 1b 9 - Barrel dimensions and stripping length Table 2b 9 Recommended crimp tool settings Table 3b 10 - Crimping and assembly tools 10 Section 3 11 - Crimp process 12 - Preparation 12 - Stripping 12 - Strand damage and end cuts 13 - Wire insulation damage 13 - Cleanliness 13 - Conductor deformation/birdcaging 13 - Examples of stripping faults 14 - Crimping 15 - Conductor location 15 - Deformation of the crimp barrel 15 - Deformation of the crimp barrel 15 - Mechanical properties of the crimped connection 16 - Methods for building up conductor cross-section 16 - Mesmoly in connector 17	- Wire size and tool chart Table 1a 4	P/N AWG
Crimping and assembly tools - Crimping and assembly tools - WARNING: Epoxy potting required - Wire size and tool chart - Table 1b - Barrel dimensions and stripping length - Table 2b - Recommended crimp tool settings - Table 3b - Crimping and assembly tools - Crimping - 12 - Stripping - 12 - Stripping - 12 - Stripping - 13 - Cleanliness - 13 - Cleanliness - 13 - Conductor deformation/birdcaging - Examples of stripping faults - Crimping - Conductor location - Examples of the crimp barrel - Mechanical properties of the crimped connection - Methods for building up conductor cross-section - Methods for building up conductor cross-section - Assembly in connector - Table 1b - PP/N - AWG - AWG - PP/N - AWG - PP/N - AWG - AWG - AWG - PP/N - AWG - AWG - AWG - PP/N - AWG - AWG - AWG - AWG - PP/N - AWG - AWG - AWG - AWG - AWG - AWG - PP/N - AWG	- Barrel dimensions and stripping length - Table 2a 5	
Crimping and assembly tools - Crimping and assembly tools - WARNING: Epoxy potting required - Wire size and tool chart - Table 1b - Barrel dimensions and stripping length - Table 2b - Recommended crimp tool settings - Table 3b - Crimping and assembly tools - Crimping - 12 - Stripping - 12 - Stripping - 12 - Stripping - 13 - Cleanliness - 13 - Cleanliness - 13 - Conductor deformation/birdcaging - Examples of stripping faults - Crimping - Conductor location - Examples of the crimp barrel - Mechanical properties of the crimped connection - Methods for building up conductor cross-section - Methods for building up conductor cross-section - Assembly in connector - Table 1b - PP/N - AWG - AWG - PP/N - AWG - PP/N - AWG - AWG - AWG - PP/N - AWG - AWG - AWG - PP/N - AWG - AWG - AWG - AWG - PP/N - AWG - AWG - AWG - AWG - AWG - AWG - PP/N - AWG	• Recommended crimp tool settings Table 3a 6	
Section 2b Only for UltiMate™ Size 08 and 11 • Crimp contacts 9 • WARNING: Epoxy potting required 9 • Wire size and tool chart Table 1b 9 • Recommended crimp tool settings Table 2b 9 • Recommended crimp tool settings Table 3b 10 • Crimping and assembly tools 11 • Crimping and assembly tools 11 • Crimp process 12 • Preparation 12 • Stripping 12 • Strand damage and end cuts 13 • Wire insulation damage 13 • Cleanliness 13 • Conductor deformation/birdcaging 13 • Examples of stripping faults 14 • Crimping 15 • Conductor location 15 • Deformation of the crimp barrel 15 • Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17	1	
• Crimp contacts 9 • WARNING: Epoxy potting required 9 • Wire size and tool chart - Table 1b 9 • Barrel dimensions and stripping length - Table 2b 9 • Recommended crimp tool settings - Table 3b 10 • Crimping and assembly tools 10 10 Section 3 • Crimp process 12 12 • Stripping 12 13 • Stripping 12 13 • Cleanliness 13 13 • Cleanliness 13 13 • Conductor deformation/birdcaging 13 • Examples of stripping faults 14 • Crimping 15 • Conductor location 15 • Mechanical properties of the crimp barrel 15 • Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17	• Crimping and assembly tools	
• Crimp contacts 9 • WARNING: Epoxy potting required 9 • Wire size and tool chart - Table 1b 9 • Barrel dimensions and stripping length - Table 2b 9 • Recommended crimp tool settings - Table 3b 10 • Crimping and assembly tools 10 10 Section 3 • Crimp process 12 12 • Stripping 12 13 • Stripping 12 13 • Cleanliness 13 13 • Cleanliness 13 13 • Conductor deformation/birdcaging 13 • Examples of stripping faults 14 • Crimping 15 • Conductor location 15 • Mechanical properties of the crimp barrel 15 • Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17		
- WARNING: Epoxy potting required - Wire size and tool chart - Barrel dimensions and stripping length - Table 1b 9 - Recommended crimp tool settings - Table 3b - Crimping and assembly tools Section 3 - Crimp process - Preparation - Stripping - Strand damage and end cuts - Stripping - Cleanliness - Conductor deformation/birdcaging - Examples of stripping faults - Crimping - Conductor location - Conductor location - Mechanical properties of the crimped connection - Methods for building up conductor cross-section - Assembly in connector - Table 1b 9 P/N AWG - Princip 10 - P/N - AWG - Table 1b 9 P/N AWG - AWG - AWG - AWG - AWG - AWG - Table 2b 9 - P/N - AWG - AWG - AWG - AWG - AWG - AWG - Table 1b 9 P/N AWG - AWG - AWG - Table 1b 9 P/N AWG - AWG - AWG - AWG - Table 1b 9 P/N AWG - AWG	Section 2b Only for UltiMate™ Size 08 and 11	
- WARNING: Epoxy potting required - Wire size and tool chart - Barrel dimensions and stripping length - Table 1b 9 - Recommended crimp tool settings - Table 3b - Crimping and assembly tools Section 3 - Crimp process - Preparation - Stripping - Strand damage and end cuts - Stripping - Cleanliness - Conductor deformation/birdcaging - Examples of stripping faults - Crimping - Conductor location - Conductor location - Mechanical properties of the crimped connection - Methods for building up conductor cross-section - Assembly in connector - Table 1b 9 P/N AWG - Princip 10 - P/N - AWG - Table 1b 9 P/N AWG - AWG - AWG - AWG - AWG - AWG - Table 2b 9 - P/N - AWG - AWG - AWG - AWG - AWG - AWG - Table 1b 9 P/N AWG - AWG - AWG - Table 1b 9 P/N AWG - AWG - AWG - AWG - Table 1b 9 P/N AWG - AWG	· Crimp contacts 9	
- Wire size and tool chart	1	
- Barrel dimensions and stripping length - Table 2b 9 - Recommended crimp tool settings Table 3b 10 - Crimping and assembly tools 11 - Crimp process 12 - Preparation 12 - Stripping 13 - Wire insulation damage 13 - Cleanliness 13 - Conductor deformation/birdcaging 13 - Examples of stripping faults 14 - Crimping 15 - Deformation of the crimp barrel 15 - Mechanical properties of the crimped connection 16 - Methods for building up conductor cross-section 16 - Assembly in connector 17		
• Recommended crimp tool settings Table 3b 10 • Crimping and assembly tools 10 Section 3 -11 • Crimp process -12 • Preparation -12 • Stripping -12 • Strand damage and end cuts -13 • Wire insulation damage -13 • Cleanliness -13 • Conductor deformation/birdcaging -13 • Examples of stripping faults -14 • Crimping -15 • Conductor location -15 • Deformation of the crimp barrel -15 • Mechanical properties of the crimped connection -16 • Methods for building up conductor cross-section -16 • Assembly in connector -17	- Wire size and tool chart Table 1b 9	P/N 🏐 AWG
• Recommended crimp tool settings Table 3b 10 • Crimping and assembly tools 10 Section 3 -11 • Crimp process -12 • Preparation -12 • Stripping -12 • Strand damage and end cuts -13 • Wire insulation damage -13 • Cleanliness -13 • Conductor deformation/birdcaging -13 • Examples of stripping faults -14 • Crimping -15 • Conductor location -15 • Deformation of the crimp barrel -15 • Mechanical properties of the crimped connection -16 • Methods for building up conductor cross-section -16 • Assembly in connector -17	- Barrel dimensions and stripping length - Table 2b 9	
• Crimping and assembly tools 11 • Crimp process 12 • Preparation 12 • Stripping 12 • Strand damage and end cuts 13 • Wire insulation damage 13 • Cleanliness 13 • Conductor deformation/birdcaging 13 • Examples of stripping faults 14 • Crimping 15 • Conductor location 15 • Deformation of the crimp barrel 15 • Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17		
Section 3 11 • Crimp process 12 • Preparation 12 • Stripping 12 • Strand damage and end cuts 13 • Wire insulation damage 13 • Cleanliness 13 • Conductor deformation/birdcaging 13 • Examples of stripping faults 14 • Crimping 15 • Conductor location 15 • Deformation of the crimp barrel 15 • Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17		
• Crimp process -12 • Preparation -12 - Stripping -12 - Strand damage and end cuts -13 - Wire insulation damage -13 - Cleanliness -13 - Conductor deformation/birdcaging -13 - Examples of stripping faults -14 • Crimping -15 - Conductor location 15 - Deformation of the crimp barrel 15 - Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17	Crimping and assembly tools10	
• Crimp process -12 • Preparation -12 - Stripping -12 - Strand damage and end cuts -13 - Wire insulation damage -13 - Cleanliness -13 - Conductor deformation/birdcaging -13 - Examples of stripping faults -14 • Crimping -15 - Conductor location 15 - Deformation of the crimp barrel 15 - Mechanical properties of the crimped connection 16 • Methods for building up conductor cross-section 16 • Assembly in connector 17		
- Preparation	Section 311	
- Stripping	• Crimp process12	
- Strand damage and end cuts	- Preparation12	
- Wire insulation damage	11 0	
- Cleanliness		
- Conductor deformation/birdcaging		└
- Examples of stripping faults		<u></u>
- Crimping		
- Conductor location	- Examples of stripping faults	•
- Deformation of the crimp barrel		
- Mechanical properties of the crimped connection 16 - Methods for building up conductor cross-section 16 - Assembly in connector		(STA)
- Methods for building up conductor cross-section 16 - Assembly in connector 17		
Assembly in connector 17		\sim
• APPENDIX • WIRE SIZE	The state of the s	
1	• APPENDIX 1 - Wire size 18	

© Fischer Connectors SA / All rights reserved

This document is the property of Fischer Connectors SA.

All communications to third parties or the reproduction in any form, even partial, are prohibited without our written consent.



Section 1

Assembly Instructions

SCOPE

This document provides general guidelines and procedures for understanding and achieving reliable crimp terminations when using Fischer Connectors closed barrel crimp contacts.

Its contents may slightly differ from individual company guidelines and procedures, and is not intended to replace them. Given the broad variety of cable sizes, stranding and qualities, it is always recommended to perform trials to verify and if necessary adapt the procedure to the particular situation and application.

If a conflict occurs between this document and Fischer Connectors' catalogues, this document will take precedence.

INTRODUCTION

 
The connection between the wire and the terminal is a critical element of any wire termination. A good termination is important because it ensures mechanical integrity and electrical performances required for the application.

 
Crimping is one common method of achieving this connection. It occurs inside the crimp barrel (terminal) of the contact. There are two types of barrels - open and closed. This specification only deals with closed barrels because all contacts referred in this document are screw-machined which is the usual process for producing this type of barrel.

Wire sections are expressed in AWG (American Wire Gauge), mm2 or CMA (Circular Mil Area). See conversion table in Appendix 1. Because the wire stranding and insulation type or thickness can vary widely within a particular wire size, it is very important to carefully verify the compatibility between the selected wire and the crimp contact by checking the barrel hole dimensions in Table 1a, and Table 1b for UltiMate™ Size 08 and 11.

Wire types:

Stranded conductors shall be used for crimping. Solid round conductors may only be used when their suitability has been proven.






The end result of a properly crimped terminal is a reliable mechanical and electrical connection.

Parts of a machined Fischer Connector crimp contact

a. Conductor crimp area b. Inspection window

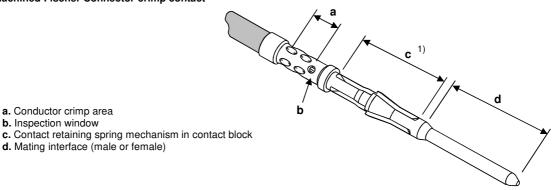

Note 1: This spring mechanism is not present on crimp contacts for Fischer UltiMate™ Size 08 & 11 products.

For this reason these contacts cannot be removed from the contact block by means of extraction tools.

Document No. 600.00.451

Rev: 2.10

d. Mating interface (male or female)



Fischer Connectors SA Saint-Prex, Switzerland Phone +41 21 800 95 95 Fax +41 21 800 39 24 www.fischerconnectors.com mail@fischerconnectors.ch

Crimping Instructions

Assembly Instructions

Section 2a

CONTENTS Page	
• Crimp contacts 4 ——	
- Wire size and tool chart	
- Barrel dimensions and stripping length - Table 2a 5	
• Recommended crimp tool settings Table 3a 6	
• Crimping and assembly tools 7	



Section 2a

Assembly Instructions

CRIMP CONTACTS

Wire Size and Tool Chart



Crimp style connectors are supplied with the appropriate quantity of crimp contacts. However, replacement contacts may be ordered according to table below.

Crimp contacts $\underline{\text{can be removed}}$ from the contact block by means of extraction tools (see extraction tool section).

TABLE 1a

Co	ontact				(Core	Series	5		UltiMate		UltiMate		UltiMate		UltiMate		UltiMate		Crimp Tool	Wire Size
Size [mm]	Polarity	Part Number	Replaces	102	103	1031	104	105	1051	07	13	18	Part Number	Part Number	AWG						
	Male	200.2113	-	•	•					•			TX00.300								
	Male	200.2172	-			•	•	•			•		TX00.301								
Ø0.5	Female	200.2114	-	•	•					•			TX00.302]	1)						
Ø0.5	Female	200.2183	-			•	•						TX00.303	TX00.240	32-28 1)						
	Female	200.2412	-					•					TX00.324								
	Female	200.2898	-								•		TX00.373								
	Male	200.2884	200.1682 200.2698	•	•	•	•	•		•		•	TX00.304								
Ø0.7	Male	200.2887	200.2210						•				TX00.307	TX00.240	28-24 1)						
<i>9</i> 0.7	Female	200.2885	200.1683 200.2760	•	•	•	•			•			TX00.305] TAGGIZ IG		20-24				
	Female	200.2886	200.2050					•	•				TX00.306								
	Male	200.2890	200.2248	•	•	•	•			•			TX00.307								
	Male	200.2891	200.2350					•	•				TX00.308	TV00 040	26-22 1)						
Ø0.9	Female	200.2892	200.1856	•	•	•	•			•			TX00.309	TX00.240	26-22						
	Female	200.2893	200.2143					•	•				TX00.310								
	Male	200.2402	-		•	•	•						TX00.311								
Ø1.3	Male	200.2403	-					•	•				TX00.338	TX00.240	24-18 ¹⁾						
	Female	200.2214	-		•	•	•	•	•				TX00.312								
64.6	Male	200.1653	-				•	•	•				TX00.313	TX00.242	18-14 ¹⁾						
Ø1.6	Female	200.1654	-				•	•	•				TX00.314	1 XUU.242	18-14						

Note 1: Exceptionally for a given AWG, the diameter of some stranded conductor designs could be larger than the hole diameter of the crimp barrel. Make sure that the conductor diameter fits into the hole. See barrel dimensions in **Table 2a** on page 5.

Legend

= Compatible

Document No. 600.00.451




Section 2a

Assembly Instructions

CRIMP CONTACTS (Cont.)

 Barrel Dimensions and Stripping Length



All contacts listed below are insulation support style machined crimp contacts except Ø1.6 contacts.

<u>^</u>!\

The wire insulation shall fit into D2.

Inspection window

ADLE 20	-									
	Contact		Barr	el dimens	Stripping length 1					
Size [mm]	Polarity	Part Number	A min	В			D2 min			
	Male	200.2113								
Ī	Male	200.2172								
Ø0.5	Female	200.2114	3.0	0.5	2.5	0.43	0.83		2.5	
5.00	Female	200.2183	(0.118")	(0.020")	(0.098")	(0.017")	(0.033")		(0.098")	
	Female	200.2412								
	Female	200.2898								
	Male	200.1682								
Ī	Male	200.2210								
Ī	Male	200.2384			3.1 (0.122")	0.60 (0.024")	1.11 (0.044")			
İ	Male	200.2698	3.4 (0.134")	0.8 <i>(0.031")</i>					2.6 (0.102")	
İ	Female	200.1683	(6.1.6.7)	(0.001)					(0.10=)	
~~-	Female	200.2050								
Ø0.7	Female	200.2760	1							
Ī	Male	200.2884		0.6	3.1	0.62				
İ	Male	200.2887	3.4 (0.134")			(0.024")	1.11		2.8	
ļ	Female	200.2885		(0.134")	(0.024")	(0.122")	0.65	(0.044")	(0.110")	(0.110")
Ī	Female	200.2886				(0.026")				
	Male	200.2248				0.82	1.56			
İ	Male	200.2350	3.3 (0.130")	0.7	3.1 (0.122")	(0.032")	(0.061")		2.6 (0.102")	
Ī	Female	200.1856	,	(0.028")	(0.122)	0.80	1.48		(0.10=)	
	Female	200.2143	3.5 (0.138")		3.3 (0.130")	(0.031")	(0.058")		(0.110")	
Ø0.9	Male	200.2890								
ļ	Male	200.2891	3.3	0.5	3.1	0.83	1.56		2.8	
ļ	Female	200.2892	(0.130")		(0.122")				(0.110")	
ļ	Female	200.2893	1							
	Male	200.2402	3.3		3.0				2.6	
Ø1.3	Male	200.2403	(0.130")	0.7	(0.118")	1.18 (0.046")	1.76 <i>(0.069")</i>		(0.102")	
ļ	Female	200.2214	3.6 <i>(0.142'')</i>	(0.028")	3.5 <i>(0.138'')</i>	(0.046)	(0.069")		2.9 (0.114")	
	Male	200.1653	5.0	NI/A	4.7	1.78	NI/A		6.0	
Ø1.6	Female	200.1654	(0.197")	N/A	(0.185")		N/A		(0.236")	

Note 1: See chapter on **Stripping** on page 12 for definition of stripping length.

All dimensions shown are in millimeters (inches) and are for reference only.

Document No. 600.00.451


Section 2a

Assembly Instructions

RECOMMENDED CRIMP TOOL SETTINGS

These settings are only for use with the adequate crimp tool (see page 7).

TABLE 3a

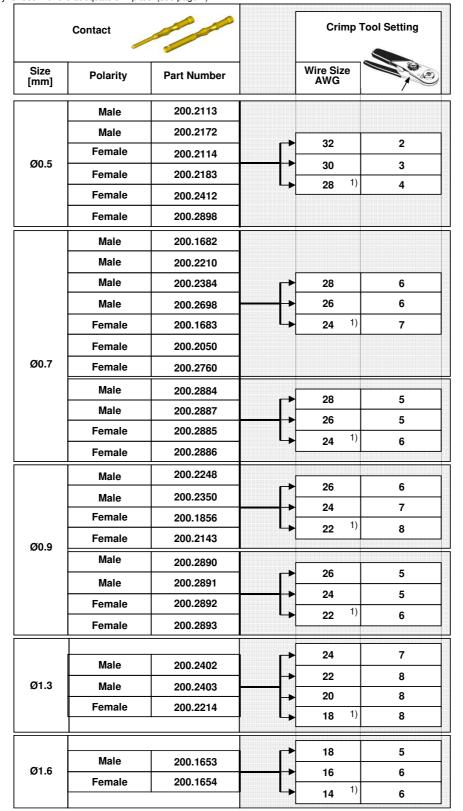

Note 1: Exceptionally for a given AWG, the diameter of some stranded conductor designs could be larger than the hole diameter of the crimp barrel. Make sure that the conductor diameter fits into the hole. See barrel dimensions in **Table 2a** on page 5.


Document No. 600.00.451

Section 2a

Assembly Instructions

CRIMPING AND ASSEMBLY TOOLS

Crimp Tool ULTRA PRECISION for closed crimp termination

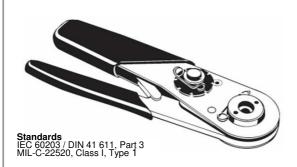

Contact Size [mm]	C Crimp Tool	Part Number
Ø0.5		
Ø0.7	BALMAR 18 - 000	TX00.240
Ø0.9	or DANIELS MH - 800	1 700.240
Ø1.3		
Ø1.6	ASTRO TOOL 615708	TX00.242

The best choice of precision crimp tools for highly reliable eight indenter crimping per US-MIL, IEC and DIN Specifications.

These hand tools have an integral mechanism to control the crimping operation to the extend that, once the crimping operation has been started, the crimping tool cannot be opened until the crimping cycle has been completed (full-cycle/ratcheting tool).

Positioners have to be ordered according to contact. See Table 1a on page 4.

Contact Insertion Tool



Material

- Handle: - Fork: Tool Steel, chrome plated

POM (black Delrin®)		

Contact Size [mm]	Part Number
Ø0.5	TX00.214
Ø0.7	TX00.210
Ø0.9	TX00.211
Ø1.3	TX00.273

Tool for inserting male and female removable crimp contacts into the contact block.

Especially recommended for small gauge and fragile wires.

Contact Extraction Tool



Material

- Housing and Plunger:

- Sleeve: - Slide:

POM (black Delrin®) Stainless Steel Tool Steel

Contact Size [mm]	Part Number
Ø0.5	TX00.213
Ø0.7	TX00.200
Ø0.9	TX00.205
Ø1.3	TX00.212
Ø1.6	TX00.201

Tool for extracting male and female removable crimp contacts from the contact block.

The sleeve of this tool is pushed over the contact, thereby releasing the contact retaining mechanism. The tool plunger is then pushed to eject the contact.

Document No. 600.00.451



Fischer Connectors SA Saint-Prex, Switzerland Phone +41 21 800 95 95 Fax +41 21 800 39 24 www.fischerconnectors.com mail@fischerconnectors.ch

Crimping Instructions

Assembly Instructions

Sect. 2b Only for UltiMate™ Size 08 and 11

CONTENTS Page	
Crimp contacts 9 -	
- WARNING: Epoxy potting required 9	
- Wire size and tool chart Table 1b 9 -	P/N 💨 😂 AWG
- Barrel dimensions and stripping length - Table 2b 9 -	
• Recommended crimp tool settings	
Crimping and assembly tools	

Sect. 2b Only for UltiMate™ Size 08 and 11 **Assembly Instructions**

CRIMP CONTACTS

WARNING

Epoxy potting required after insertion of contacts into insulator. For all UltiMate body styles Size 08 and 11.

For UR01, UR02, UR03 and UP50 body styles this epoxy potting material should cover the contacts and ideally not exceed the rear surface of the insulator (red circle on picture).



Wire Size and Tool Chart



Crimp style connectors are supplied with the appropriate quantity of crimp contacts. However, replacement contacts may be ordered according to table below.


Crimp contacts **cannot** be removed from the contact block by means of extraction tools.


TABLE 1b


IADEL	- ''															
											Crimp Tool					
	Contact			UltiMate Size					UltiMate Size							Wire Size
Size [mm]	Polarity	Part Number	Replaces	07	08	11	13	18	-	Part Number	Part Number	AWG				
00.7	Male	200.2895	-		•	•				TX00.301	TX00.240	1) 28-24				
Ø0.7	Female	200.2896	-		•	•				TX00.370	1 700.240	20 24				

Note 1: Exceptionally for a given AWG, the diameter of some stranded conductor designs could be larger than the hole diameter of the crimp barrel. Make sure that the conductor diameter fits into the hole. See barrel dimensions in Table 2b below.

   Legend







All contacts below are injected insulating support style crimp contacts.

Inspection

The wire insulation shall fit into D2.

TABLE 2b

Contact				Barr	el dimens	sions		Strip	oping leng	th
Size [mm]	Polarity	Part Number	A min	В	С	D1 min	D2 min			
Ø0.7	Male	200.2895	3.4	0.6	3.1	0.62(0.024")	1.01		2.8	
20.7	Female	200.2896	(0.134")	(0.024'')	(0.122")	0.65(0.026")	(0.039'')		(0.110")	

All dimensions shown are in millimeters (inches) and are for reference only.




Sect. 2b Only for UltiMate™ Size 08 and 11 **Assembly Instructions**

RECOMMENDED CRIMP TOOL SETTINGS

These settings are only for use with the adequate crimp tool (see below)


TABLE 3b

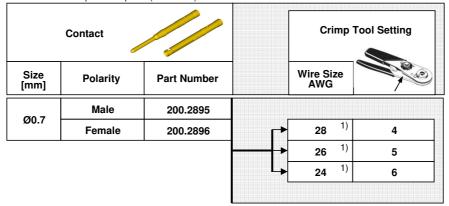

Note 1: Exceptionally for a given AWG, the diameter of some stranded conductor designs could be larger than the hole diameter of the crimp barrel. Make sure that the conductor diameter fits into the hole. See barrel dimensions in **Table 2b** on page 9.

CRIMPING AND ASSEMBLY TOOLS

Crimp Tool ULTRA PRECISION for closed crimp termination

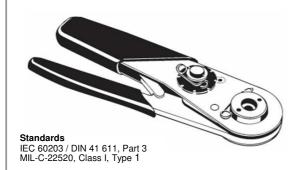

Contact Size [mm]	C Crimp Tool	Part Number
Ø0.7	BALMAR 18 - 000 or DANIELS MH - 800	TX00.240

The best choice of precision crimp tools for highly reliable eight indenter crimping per US-MIL, IEC and DIN Specifications.

These hand tools have an integral mechanism to control the crimping operation to the extend that, once the crimping operation has been started, the crimping tool cannot be opened until the crimping cycle has been completed (full-cycle/ratcheting tool).

Positioners have to be ordered according to contact. See Table 1b on page 9.

Contact Insertion Tool



Contact Size [mm]	Part Number
Ø0.7	TX00.372

Tool for inserting male and female crimp contacts into the contact block.

- Handle: - Fork: POM (black Delrin®) Tool Steel, chrome plated

Document No. 600.00.451




Saint-Prex, Switzerland Phone +41 21 800 95 95 Fax +41 21 800 39 24 www.fischerconnectors.com mail@fischerconnectors.ch

Crimping Instructions

Assembly Instructions

Section 3

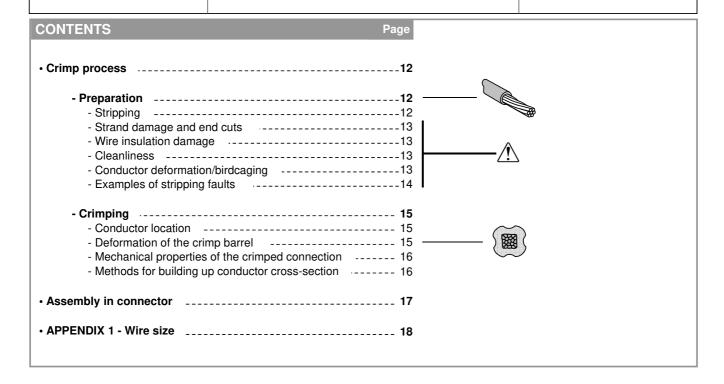

© Fischer Connectors SA / All rights reserved
This document is the property of Fischer Connectors SA.
All communications to third parties or the reproduction in any form, even partial, are prohibited without our written consent.



Section 3

Assembly Instructions

CRIMP PROCESS

Stranded conductors shall not be soldered/tin dipped in that part which is intended to be crimped. After crimping, no additional soldering should take place.

Some reasons for failure of crimped joints to meet minimum tensile requirements include nicked wires, nicked or ruptured strands, strand turn back at crimp joint, and ruptured wires outside of the crimped terminal. To avoid these problems, use the correct size wire for the barrel, prepare your wire carefully, and use the proper crimping tool.


PREPARATION

Stripping:

Wire insulation may be removed using chemical, thermal or mechanical strippers. Chemical insulation stripping agent shall be used only for solid wires.

In order to obtain a good and stable crimped connection, it is necessary to strip the wire correctly, i.e. the required stripping length depends on the type and size of the crimp barrel used as described below.

See Table 2a, and 2b for UltiMateTM Size 08 and 11, for barrel dimensions A and B, position of inspection hole C, and stripping length.

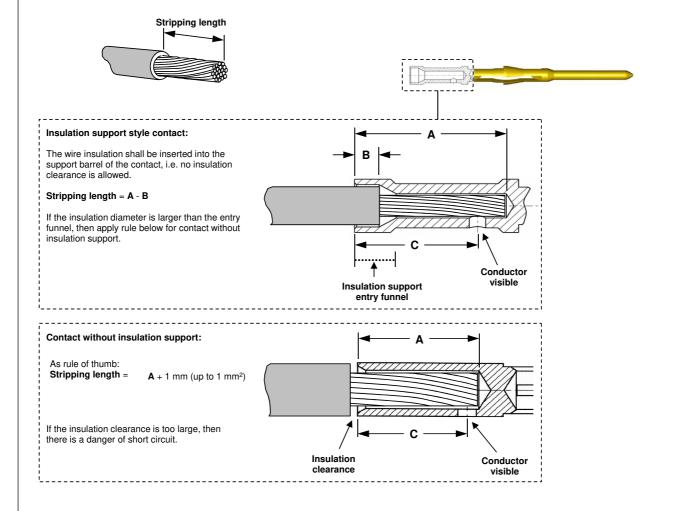

Document No. 600.00.451



Section 3

Assembly Instructions

CRIMP PROCESS (Cont.)

Strand damage and end cuts:

The strands stripped part of the conductor shall not be damaged, for example partly or totally broken, as it can lead to degraded performance. Tools utilized to accomplish wire cut shall be selected and used to provide repetitive and consistent wire cut terminations.

The process of wire cutting shall be performed such that the cut ends are uniform and all strands are the same length.





Do NOT tin the wire with solder before crimping

Wire insulation damage:

Indents on the wire insulation caused by the stripping tool which do not damage the insulation are permitted if there are no cuts, breaks, cracks or splits in insulation. Coatings added over insulation base material such as resin coatings over polyimide are not considered to be part of the insulation.


Cleanliness:

The stripped part of the conductor shall be clean and free of heavy, non-conductive films such as oxides, sulfides, and similar substances., and free from particles of insulation.

Conductor deformation/birdcaging:

The strands shall not be flattened, untwisted, buckled, kinked or otherwise deformed.

The lay of the strands shall be correct. If the lay has been disturbed, it may be restored by a light twist to approximate the original spiral lay of the wire. Care should be taken not to over-twist the strands.

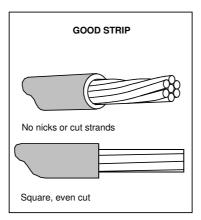

Document No. 600.00.451




Section 3

Assembly Instructions


CRIMP PROCESS (Cont.)

 Examples of Stripping Faults





 
Distance between stripping blades too small: Strands damaged or removed



Not appropriate stripping tool: **Cut at angle**



 Blunt stripping blades or incorrect distance between the blades: Tapered, torn, split or burred insulation




The grip of the stripping tool is damaged or there are metal shavings within the grip: Insulation is damaged.




Stripping blades either blunt or not correctly adjusted:

 Particles of insulation left on the stripped part of the wire



 Inappropriate handling of stripped wire: **Strands untwisted**




Inappropriate handling of stripped wire:
Strands untwisted and wire bundle splayed



Inappropriate handling of stripped wire:

• Wire strands extend beyond wire

 - Wire strands extend beyond wire insulation outside diameter.
- Wire strands are kinked.



The strands are overtwisted; therefore the distribution of strands within the crimp barrel is not assured (increase of the wire cross-section)



Section 3

 
Assembly Instructions

CRIMP PROCESS (Cont.)

CRIMPING

Conductor location:


The conductor shall be correctly located in the barrel, i.e. to the correct depth. It must be visible inside the inspection window. All conductor strands shall be within the barrel. There shall be no damaged strands.




Deformation of the crimp barrel:

The figures below show the crimping of the same contact but with two different wire sizes.

The smaller wire requires a deeper deformation of the crimp barrel which is achieved by selecting the recommended crimp tool setting in **Table 3a**, and **3b** for UltiMate™ Size 08 and 11.

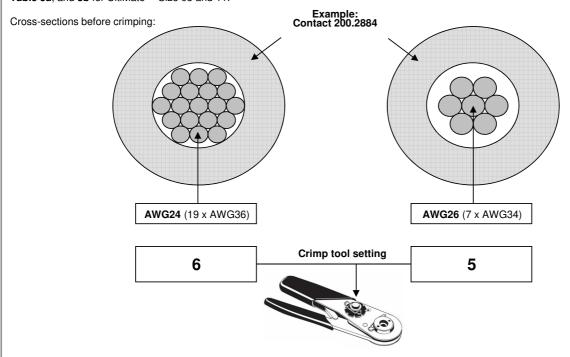

With the aid of cross-section equipment it is possible to verify the quality of the crimp. Each strand should be compressed and deformed, crimp settings may be adjusted to get void free strand compression.

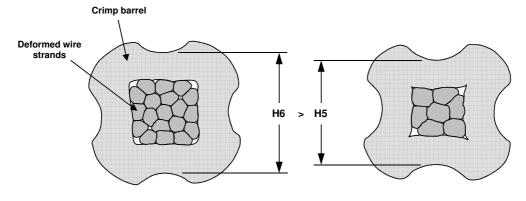

Document No. 600.00.451



Section 3

Assembly Instructions

CRIMP PROCESS (Cont.)

Mechanical Properties of the Crimped Connection

For each contact and compatible wire combination, a proper crimp requires a crimp dimension (or height) that offers the highest performance.

The tensile test or pull test is the most widely used field test for evaluating the mechanical properties of the crimped connection. The chart on the existing page shows the requirements of the IEC 60352-2 for various wire sizes. The force indicates the minimum acceptable force to break or separate terminal from the conductor.

- If the crimp dimension is too small, then the conductor is overcrimped and the wire strands could be damaged. This could also create a heat rise across the termination because of increased resistance.
- If this dimension is too large, then the conductor is undercrimped and the wire strands will not be deformed enough.

In both cases the result will be a lower pull out force.

Pull out force of crimped connections

Conductor cr	Conductor cross-section									
[mm²]	AWG ²⁾	[N]								
0.05	30	6								
0.08	28	11								
0.12	26	15								
0.14	-	18								
0.22	24	28								
0.25	-	32								
0.32	22	40								
0.5	20	60								
0.75		85								
0.82	18	90								

Note 1: Source: IEC 60352-2, § 5.2.2.1

Note 2: For information only

Methods for Building up Conductor Cross-Section



In some industries, the use of the methods described below is not recommended.

Normally, crimped connections are made with one wire in a crimp barrel. However under certain circumstances, when the wire size is smaller than the acceptable range of the crimp barrel, one of the following methods or a combination of both can be used to buildup the correct cross-section:

• The conductor is folded or bent back:



 The conductor area is increased by the use of bare (non-insulated) filler conductors as needed:



- Attention should be paid to the following items:
- The filler shall be visible at the wire entry end of the barrel.
- The filler conductors and/or the wire conductor are visible in the inspection window of the contact.
- The filler conductor is of the same type conductor as the wire being crimped into the contact.
 (Gauge can be different as needed but the base metal and the plating, if any, need to be the same).

Document No. 600.00.451



Section 3


Assembly Instructions

ASSEMBLY IN CONNECTOR




A certain play in the bloc is necessary for the crimp contacts. Never twist the cable and wires during the cable assembly.



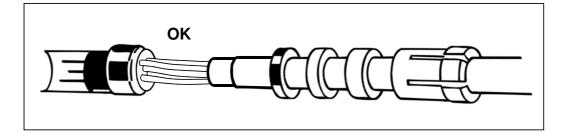



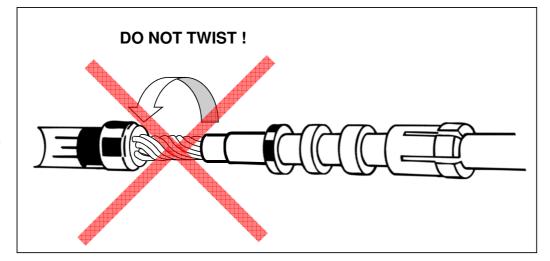

Document No. 600.00.451

Section 3

Assembly Instructions

PEN	1DI	X	1 -	W	/IF	RΕ	S	ΙZΙ	Ε																										
nis ch	art i	s in	tend	dec	d fo	or re	efe	ren	се	only	y.																								
Effective Cross-Sectional Area	mm^2	0.258	0.326	acc.u	0.383	0.329	0.410	0.518	0.567	0.509	0.609	0.524	0.519	0.653	0.823	0.901	0.815	0.968	0.826	0.823	1.038	1.309	1.433	1.220	1.324	1.309	1.330	1.650	2.081	2.279	1.940	2.088	2.115		
Effe Cross-Sect	CMA 1)	509	642	104	755	920	810	1022	1119	1005	1201	1034	1025	1288	1624	1779	1608	1910	1630	1625	2048	2583	2828	2408	2613	2584	2625	3257	4107	4497	3829	4121	4174		
neter	mm	0.57	0.64	0.76	0.81	0.74	0.72	0.81	0.97	0.91	0.97	1.02	0.97	0.91	1.02	1.17	1.17	1.22	1.17	1.22	1.15	1.29	1.52	1.37	1.47	1.50	1.50	1.45	1.63	1.85	1.73	1.78	2.18		
Diameter	Inches	0.023	0.025	0:030	0.032	0.029	0.028	0.032	0.038	9:0:0	0.038	0.040	0.038	0.036	0.040	0.046	0.046	0.048	0.046	0.048	0.045	0.051	0.060	0.054	0.058	0.059	0.059	0.057	0.064	0.073	0.068	0.070	0.086		
Stranding		Solid	Solid	US/J	19/34	26/36	Solid	Solid	7/28	10/30	19/32	26/34	41/36	Solid	Solid	7/26	16/30	19/30	41/34	65/36	Solid	Solid	7/24	19/29	26/30	65/34	105/36	Solid	Solid	7722	19/27	41/30	105/34	•	
AWG		23	22	77	77	22	77	70	70	20	70	20	20	<u>6</u>	8	22	e	8	8	82	17	16	92	16	9	16	92	15	14	7	14	#	14		
tive onal Area	mm ²	0.002	0.003	cmn.n	900.0	800:0	0.010	0.013	0.016	0.020	0.025	0.032	0.035	0.038	0.040	0.051	0.056	0.060	0.064	0.081	0.089	0.095	0.102	0.112	0.129	0.129	0.141	0.127	0.151	0.162	0.205	0.224	0.201	0.241	0.205
Effective Cross-Sectional Area	CMA 1)	3.9	6.2	D.	12.5	15.7	19.8	25.0	31.5	39.8	50.1	63.2	69.2	74.3	7.67	101	110	118	127	160	175	98	202	221	254	254	278	250	288	320	404	442	388	475	405
eter	mm	0:050	0.063	0.080	0:030	0.10	0.11	0.13	0.14	0.16	0.18	0.20	0.23	0.20	0.23	0.25	0:30	0.33	0.29	0.32	0.38	0.41	0.36	0.43	0.46	0.40	0.48	0.51	0.51	0.45	0.51	0.61	0.58	0.64	0.61
Diameter	lnches	0.0020	0.0025	0.0031	0.0035	0.0040	0.0045	0:00:0	0.0056	0.0063	0.0071	0.0080	0.0090	0.0080	0.0089	0.010	0.012	0.013	0.011	0.013	0.015	0.016	0.014	0.017	0.018	0.016	0.019	0.020	0.020	0.018	0.020	0.024	0.023	0.025	0.024
Stranding		Solid	Solid	Solid	Solid	Solid	Solid	Solid	Solid	Solid	Solid	Solid	7/40	19/44	Solid	Solid	7/38	19/42	Solid	Solid	2/36	19/40	1/27	7/35	65/44	Solid	7/34	10/36	19/38	Solid	Solid	7/32	10/34	19/36	41/40
AWG		44	42	40	Ŗ	38	37	36	35	34	R	32	32	32	<u>ب</u>	30	30	30	29	28	78	28	27	27	27	56	56	56	56	52	24	24	24	24	24

Document No. 600.00.451