


OVERMOLDING ULTIMATE

UP01 WITH STRAIGHT OVERMOLDING



SIZE	ØX	ØY	ØZ	L1	L2	L3
07	2.0...3.8	6.4	12.0	48.7	26.5	~39
	>3.8...5.1	7.6				
08	2.0...3.8	8.5	14.5	57.5	30.0	~44
	>3.8...5.9	9.1				
11	2.0...6.5	10.6	18.0	62.8	36.0	~50
	>6.5...9.0	12.1				
	>9.0...10.0					
13	2.0...9.7	13.6	21.7	77.8	42.0	~61
15	2.0...10.5	15.6	23.7	77.8	42.0	~61

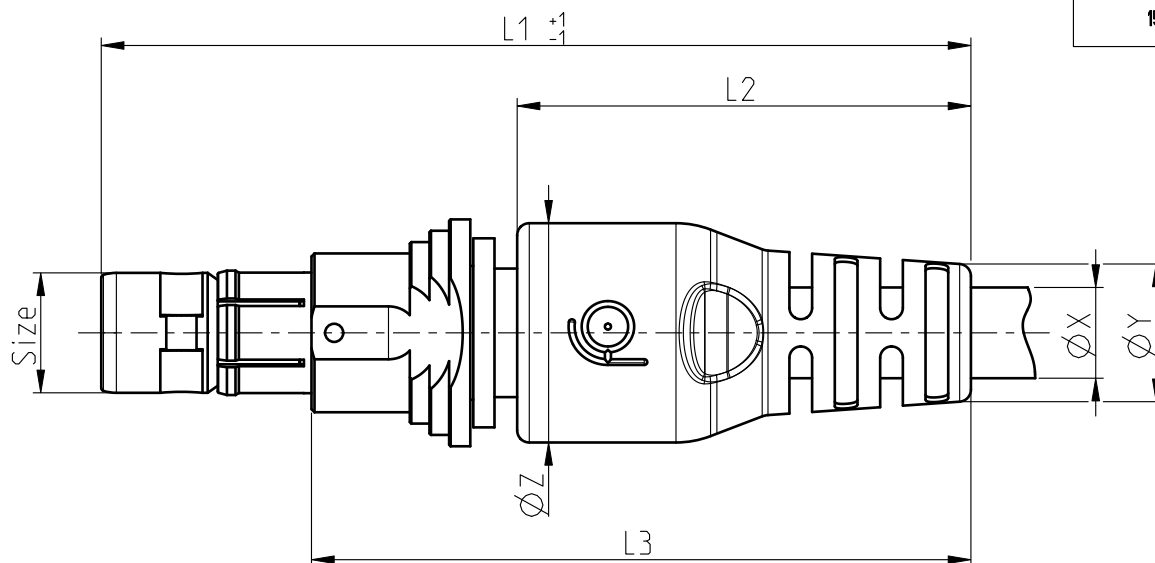

All dimensions in mm

Rev.

Pages

Notes :

1) General tolerances: $\pm 0.5\text{mm}$

600545

3

1/3



fischer
CONNECTORS

www.fischerconnectors.com

Information provided herein is believed to be accurate at time of publishing. Fischer Connectors reserves the right to make modifications on products for continuous improvement without prior notice.

OVERMOLDING ULTIMATE


UP01 WITH RIGHT ANGLE OVERMOLDING

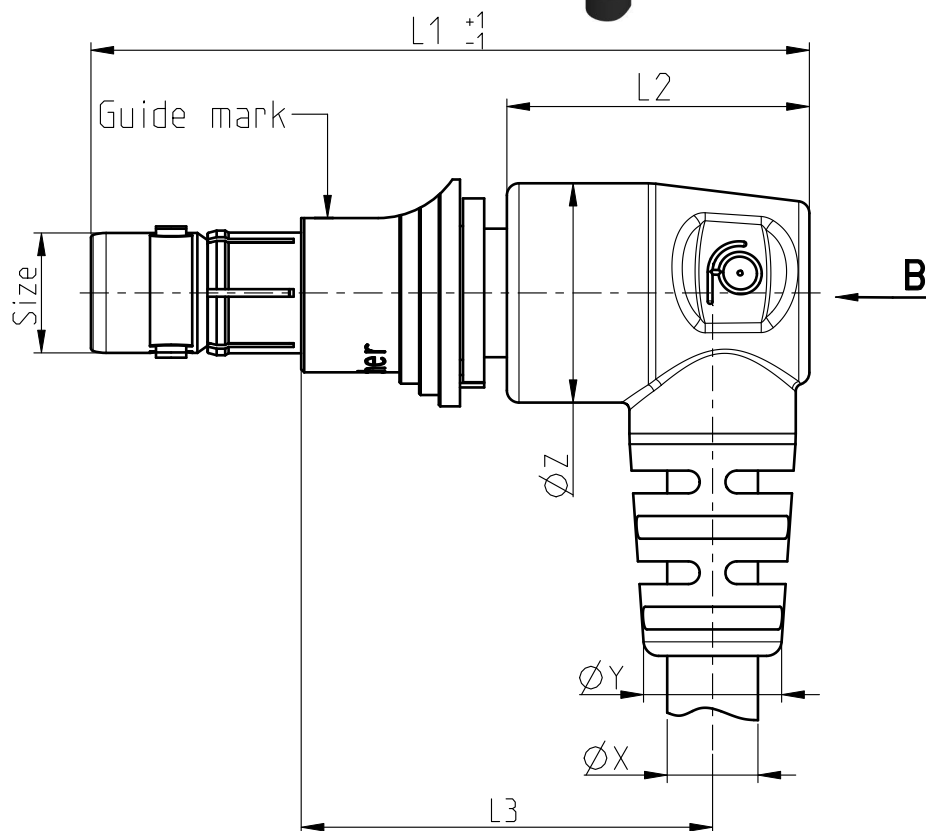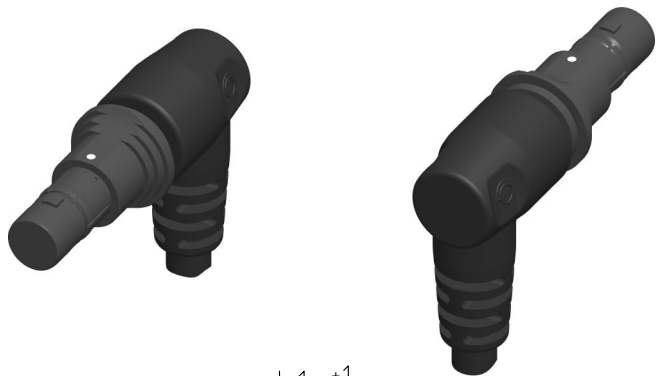

SIZE	ØX	ØY	ØZ	L1	L2	L3	L4	L5
07	2.0...3.8	6.4	12.0	36.2	14.0	~21	20.0	26.0
	>3.8...5.1	7.6						
08	2.0...3.8	8.5	14.5	47.5	20.0	~27	24.0	31.3
	>3.8...5.9	9.1						
11	2.0...6.0	10.6	18.0	51.8	25.0	~31	30.0	39.0
	>6.0...10.0	12.1						
13	2.0...9.7	13.6	21.7	65.8	30.0	~40	30.0	40.9

Cable Orientation⁽²⁾

(View from B)

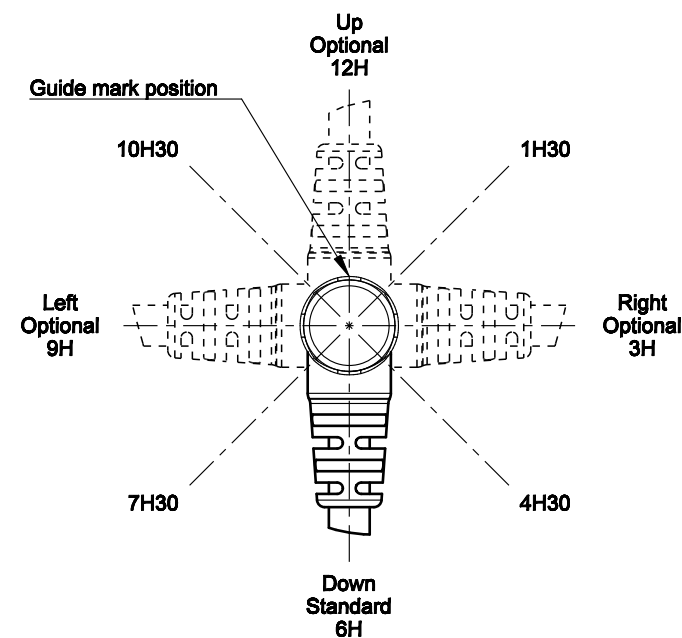

All dimensions in mm

600545

Rev.

3

Pages

2/3

Notes :

- 1) General tolerances: $\pm 0.5\text{mm}$
- 2) Can be positionned in 45° increments

fischer
CONNECTORS

www.fischerconnectors.com

Information provided herein is believed to be accurate at time of publishing. Fischer Connectors reserves the right to make modifications on products for continuous improvement without prior notice.

OVERMOLDING ULTIMATE

UR50 WITH STRAIGHT OVERMOLDING



SIZE	ØX	ØY	ØZ	L1	L2
07	2.0...3.8	6.4	12.0	47.7	26.5
	>3.8...5.1	7.6			
08	2.0...3.8	8.5	14.5	57.2	30.0
	>3.8...5.9	9.1			
11	2.0...6.5	10.6	18.0	62.5	36.0
	>6.5...9.0	12.1			
	>9.0...10.0				
13	2.0...9.7	13.6	21.7	78.3	42.0

